

AC/DC/IR HIPOT TESTER MODEL19070 & 19050 SERIES

Complete Dielectric Testing Solution

The Chroma 19050 Series electrical safety testers are advanced digital hipot testers with load and line regulations that help ensure measurement integrity. The Multi-step capability allows users to perform multiple tests in sequence, such as AC hipot followed by IR.

The 19050 Series Hipot Testers have 3 models available for selection: the 19052, 19053, and 19054. The 19052 includes AC/DC hipot testing and IR (Insulation Resistance) measurement while the 19053 provides 8 scan channels for AC/DC hipot testing and IR measurement. The 19054 provides 4 scan channels for AC/DC hipot testing and IR measurement in a single compact unit.

The 19070 Series has 2 models available for selection: the 19071 and the 19073. The 19071 is for AC Hipot testing while the 19073 combines both AC/DC hipot with IR measurement into a single compact unit.

Open Short Check (OSC)

The OSC function is used to check whether the connection is an open circuit between the instrument and the DUT or if there is a

GPIB

breakdown inside the DUT before testing for electrical safety.

Flashover (ARC) Detection

The 19070 and 19050 series are sensitive enough to monitor for current spikes even if they do not exceed the maximum trip current level.

Ground Continuity Check (GC)

All of the 19070 and 19050 series testers have a ground continuity check feature to determine if the resistance between the ground pin of the power cord and any exposed metal on the product is less than 1Ω .

Ground Fault Interrupt (GFI)

GFI is required by the National Electrical Code

in wet locations. Such devices automatically interrupt power when a ground current > 0.5mA exists for more than a few milli-seconds to protect users. **Quick Discharge** For DC hipot and IR tests, the DUT is

discharged back through the HV transformer attaining a rapid and safe discharge.





MODEL 19070 SERIES **19050 SERIES**

KEY FEATURES

- ACWV/DCWV/IR 3 in 1 hipot tester
- Programmable output voltage to 5kV AC and 6kV DC
- 1kV insulation resistance test
- Insulation resistance measurement from 1M Ω to 50G Ω
- Ground continuity check (GC)
- Standard RS-232 interface
- Open short check(OSC) function
- GFI shutdown of the instrument when current imbalance > 0.5mA
- Flashover (ARC) detection
- Quick discharge of DUT in IR and DC test
- Pause mode
- UL and TUV approved (*see spec.)
- CE mark
- Programmable ramp/fall and test time
- Programmable high/low limit
- Save/Recall program test function
- Remote control and interface support

MAIN FUNCTIONS

FLASHOVER DETECTION (ARC)

Fast transients in voltage or current during hipot testing are called electrical flashover. Normally, with AC line frequency (50Hz/60Hz) or DC hipot testing, the leakage current is the same 50Hz/60Hz or DC (charge current excepted). As shown in Figure 1, leakage current varies smoothly.

In contrast, when electrical discharge occurs due to poor insulation materials, electrode gaps, surface clearances, etc., fast transients in leakage current become apparent, as shown in Figure 2. Most of the electrical safety regulations state a necessity of withstand strength test. Nevertheless, general hipot testers only detect the RMS value of leakage current without the capability to detect flashover. Therefore, a hipot tester equipped with FLASHOVER detection function is necessary.

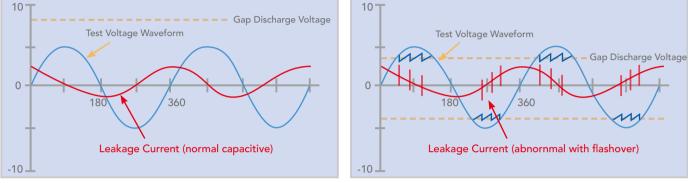



Figure 1 : Normal Leakage Current Waveform

Figure 2 : Leakage Current Waveform when flahover occurred

OPEN/SHORT CHECK (OSC)


The O.S.C function is used to check whether the circuit connection between the instrument and the DUT (equipment under test) is open or shorted before the electrical safety test begins. Without checking for an open or short, it is possible for the connection to be bad due to a bad lead or relay oxidation, but for the tester to still register a PASS. In some cases, the DUT is shorted before testing. Testing a shorted DUT continually leads to instrument failure due to suffering the high load current. Therefore, it is necessary to check the open and short circuit to ensure the test is effective and protects the instruments.

Normally, a DUT has capacitive loads (Cx) from tens to thousands of pF. If the connection is open, the capacitance will appear and its total capacitive load will be lower than that of normal conditions. If the DUT is shorted, the total capacitive load is higher than that of normal conditions. Therefore, we can measure the value of the capacitive load to check whether the contact is good or not.

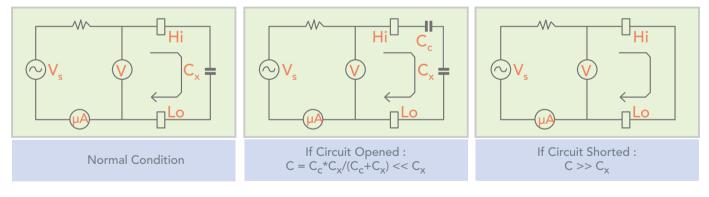


GROUND FAULT INTERRUPT (GFI)


As requirements for test environments state that the test equipment must be equipped with an auto interrupt device, Chroma has embedded Ground Fault Interrupt (GFI) function in the 19050 and 19070 Series testers. When the current meters A1 and A2 detect difference (i2-i1=iH) between the values i1 and the actual i2 test current is too high, the instrument can cut the power immediately to protect the human body. It is not only compliant with the safety standard but also provides more safeguards for testing personnel.

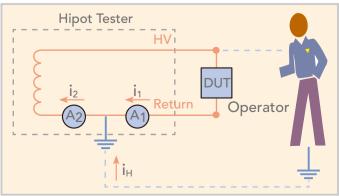

PANEL DESCRIPTION

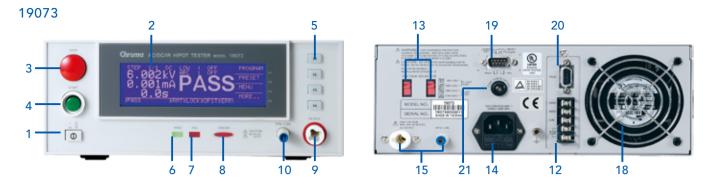



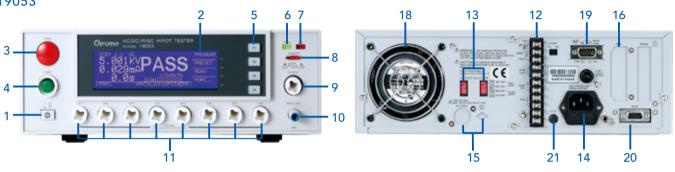

- 1. LINE Switch
- 2. Window Display
- 3. Stop Button
- 4. Start Button
- 5. Function Keys (F1~F4)
- 6. Pass Indicator
- 7. Fail Indicator
- 8. Test Indicator

- 9. HV Output
- 10.RTN/LOW
- 11.8 channels HV Output (19053 only)
- 12.Remote I/O
- 13.LINE Voltage Selector
- 14. Power Cord Receptacle
- 15.Rear HV Output & RTN/LOW

- 16. GPIB/Printer Interface (option)
- 17. Scan Interface (option)
- 18. Fan
- 19. Remote Interface
- 20. RS-232 Interface
- 21. Continuity Test O/P

APPLICATIONS

- Production test for appliances, instruments and information technology equipment in compliance with UL, IEC, TUV and other standards such as EN 60335, EN 60950, EN 61010, CSA C22.2 No.1010.1, UL 3111 and UL 1950
- Transformer electrical safety tests
- Various electronic components tests

ORDERING INFORMATION

19071 : ACWV Hipot Tester 19073 : ACWV / DCWV / IR Hipot Tester A190701 : Remote control box A190702 : 40kV test probe A190704 : Start switch A190706 : 19" rack mount kit A190708 : ARC verification fixture 19052 : Hipot Tester (ACWV / DCWV / IR) 19053 : Hipot Tester (ACWV / DCWV / IR / 8CH SCAN) 19054 : Hipot Tester (ACWV / DCWV / IR / 4CH SCAN) A190344 : HV gun (SP02) A190508 : GPIB interface A190512 : Auto control TR. scan box (Model 19053 only) A190517 : 19" rack mount kit A190518 : Hipot tester software for 19050 series

SPECIFIC		IS						
Model		19071	19073	19052	19053	19054		
Mode			ACWV	ACWV / DCWV / IR	ACWV / DCWV / IR	ACV / DCV	/ IR / SCAN	
Scanner Unit			-	-	-	8 ports, \pm phase	4 ports, \pm phase	
Withstandi	ng Volta	ge Test						
Output Voltage			AC : 0.05 ~ 5kV, DC : 0.05 ~ 6kV					
Load Regulation			≦(1%+5V)					
Voltage Resolution			2V					
Voltage Accuracy			\pm (1% of reading + 5 counts)					
Cutoff Current			AC:0.1~20mA	AC : 0.1mA ~ 20mA		AC : 0.1 ~ 30mA,		
Current Resolution			DC: 0.01mA ~ 5mA DC: 0.01 ~ 10mA AC: 1μA, DC: 0.1μA AC: 1μA, DC: 0.1μA					
Current Accuracy			±(1% of reading + 5 counts)					
Output Frequency			50Hz / 60Hz					
Test Time			0.3 ~ 999 sec., continue					
Ramp Time			0.1 ~ 999 sec., off					
Fall Time			0.1 ~ 999 sec., off					
Dwell Time			0.1 ~ 999 sec., off					
Waveform			Sine wave					
Insulation F	Resistance	0	1					
			-		DC : 0.05 ~ 1kV	1		
Output Voltage			-		DC . 0.03 ~ TKV 2V			
Voltage Resolution			-					
Voltage Accuracy IR Range			-	1M Ω ~ 50G Ω	\pm (1% of reading + 5 c	1000000000000000000000000000000000000		
Resistance Accuracy		1.00M Ω ~ 25.00M Ω	-	110122~30032	\pm (5% of reading \pm 2% of full scale)			
		22.0 M Ω ~250.0MΩ	-	$\pm (49)$ of reading \downarrow E country				
				\pm (4% of reading + 5 counts)				
	≧500V	0.220GΩ~1.000GΩ	-		\pm (5% of reading + 2% of full scale) \pm (5% of reading + 2% of full scale)			
		1.000GΩ~2.500 GΩ	-	\pm (7% of reading + 5 counts)	\pm (5% of reading + 2% of full scale) \pm (15% of reading + 1% of full scale)			
		2.20GΩ~10.00GΩ	-					
		10.00GΩ~50.00GΩ	-	\pm (12% of reading + 5 counts) \pm (15% of reading + 1% of full scale)			i scale)	
	≦500V	0.10 MΩ~25.00MΩ	-		\pm (10% of reading + 2% of full scale) \pm (15% of reading + 1% of full scale)			
		22.0MΩ~250.0MΩ	-	\pm (7% of reading + 5 counts)				
0.220 GΩ~1.000GΩ Flashover (ARC) Detection			- \pm (15% of reading + 1% of full scale)					
		tection						
Setting Mode			Programmable setting					
Detection Current			AC : 1mA ~ 2	AC : 1mA ~ 20mA AC : 1mA ~ 20mA AC : 1mA ~ 15mA ; DC : 1mA ~ 10mA				
Secure Pro	tection F	unction			_1			
Fast Outpu			0.4ms after NG happen					
Ground Fault Interrupt			0.5mA ±0.25mA AC, ON/OFF					
Panel Operation Lock			Present password					
Continuity			1~5	$\Omega \pm 0.2 \Omega$, ON/OFF	1Ω	\pm 0.2 Ω , ON/OFF	-	
GO/NG Ju		Window						
Indication,	Alarm		GO : Short sound, Green LED ; NG : Long sound, Red LED					
Data Hold			Least tests data memories					
Memory Storage			10 tests setups with 60 steps pre setup 99 steps or 99 groups for total 500 memory					
Remote &	Interface							
Remote control			Input : Start, Stop, Interlock (at 11 pin terminal block only) Output : Under test, Pass, Fail					
Communication Interface			RS485 (option) RS232 (standard), GPIB (option)					
General			1		1\3232 (
	Environ	aant		Tomporature + 0°C - 40°C	· Humidity · 15% +c 05	% Р H @ < л0°С		
Operation Environment Power Requirements			Temperature : 0°C~40°C ; Humidity : 15% to 95% R.H @ ≦40°C 100V/120V/220V/240V (AC ±10%), 50/60Hz					
			300W			•••		
Power Consumption			270, 105, 25		500W			
Dimension (W x H x D)			270x105x35	0 mm/10.63x4.13x13.78 inch	320 x 105 x 400 mm/12.6x4.13x15.75 inch			
Weight			11 kg / 24.23 lbs Approx. 15.4 kg / 33.92 lbs					
Certificatio	n			UL, TUV, CE	UL, TUV, CE	CE	UL, TUV, CE	

*All specifications are subject to change without notice.

Get more product & distributor information in Chroma ATE APP



Thurlby Thandar Instrument Distribution Glebe Road, Huntingdon, PE29 7DR, UK +44 (0)1480 412 451 sales@ttid.co.uk www.ttid.co.uk